



Vehicle FIAT / Stilo 1.9 JTD 8V / 10/2001 - 12/2003 / Squareback/hatchback limousine  
 Country of manufacture I  
 Cubic capacity/Power 1.9 / 85 kW  
 Motor tag 192 A 1.000  
 RB key FIA 1618

## Known fixes and bulletins

### Bulletin

- Driveability
- Engine management
- Engine mechanical
- Exhaust
- Fuel system
- Noise, vibration and harshness

### Affected vehicles

- All models with 1,9D JTD/16V/Multijet/2,4D JTD 20V engines.

### Problem

- Engine jerking.
- Hesitation when accelerating at 1800-2000 rpm.

### Cause

- Exhaust gas recirculation (EGR) valve not operating properly.



### Remedy

Parts			
Description	Part number	Engine	Quantity
Restrictor plate	71751468	1,9D JTD/Multijet/16V/2,4D JTD 20V	1
Gasket	55191883	1,9D JTD/Multijet/16V/2,4D JTD 20V	2
Restrictor plate	71751468	1,9D JTD 8V	1
Gasket	55191883	1,9D JTD 8V	2

- Check operation of thermostat.
- Check engine oil level correct.
- Check for contamination of fuel.
- Check fuel filter.

- Check intake system for leaks.
- Check mass air flow (MAF) sensor.
- Check for oil in intake system.
- Check fuel injectors for leaks.
- Check fuel injectors for correct type.
- Ensure EGR system operates correctly.
- Remove EGR valve and fit restrictor plate:
  - 1,9D JTD/Multijet/16V/2,4D JTD 20V Fig.1.
  - 1,9D JTD 8V Fig.2.

Fig.114235 Fig.114239

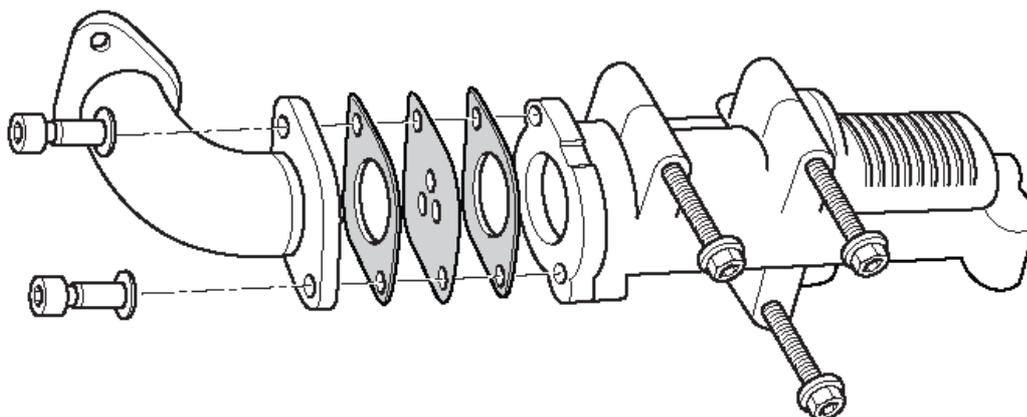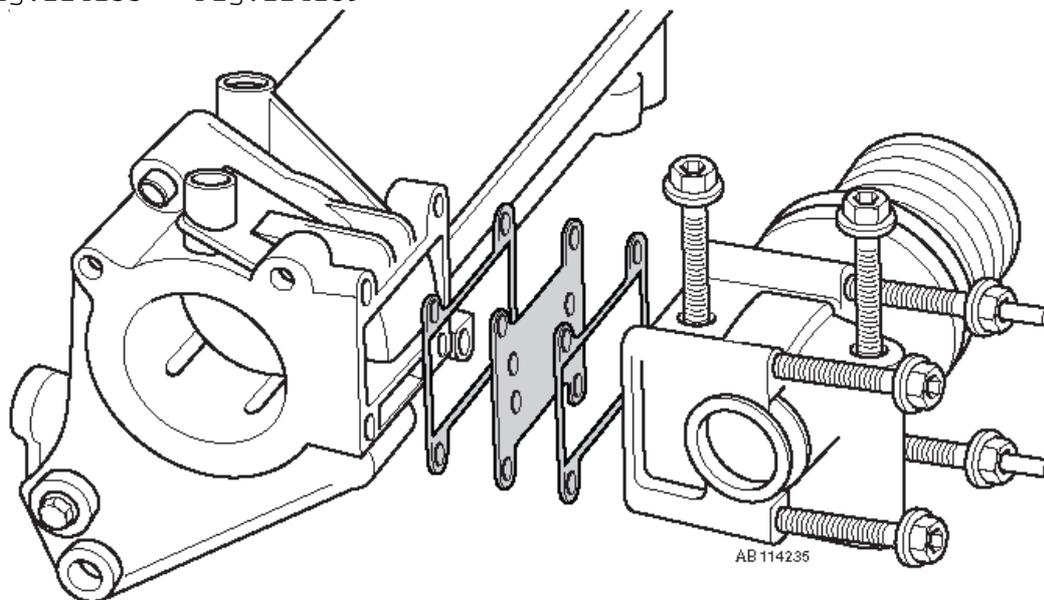

AB114239